# Textile & Leather & Shoes & Bag Products Recall Notifications - 2026 report 3

In order to protect the legitimate rights and interests of consumers, countries such as the European Union, the United States, Canada and Australia have established special early warning and notification mechanisms to notify substandard products. CTT summarizes the notification information related to textile & leather & shoes & bag products in the third quarter of 2026. During this period, the European Union announced 26 notified cases, the United States announced 8 notified cases, Canada announced 2 notified cases, and Australia announced 3 notified cases, for a total of 39 cases. Among the countries of origin involved, including China, Bangladesh, Cambodia, France, United Kingdom, Ireland and United States. Among which 25 cases were related to China, accounting for 64%; The types of risks involved in the recalled products include: rope straps cause injury and strangulation hazard, burn hazard, chemical hazard, suffocation/choking hazard, etc. More details are as follows:

**EU RAPEX:**

| Risk | Regulation / Standard | Notification count | Products |
|---|---|---|---|
| Chemical hazard | REACH<br>POPs | 20 | Wallet、Cosmetic bag：Phthalates(DEHP)<br>Cushion cover、Cloth napkin：PFAS(PFCA、PFOAs)<br>Coat、Children's rain jacket：PFAS(PFCA)<br>Children's rain jacket：PFAS(PFCAs、PFOAs)<br>Waterproof mattress protector：PFAS(PFHxA)<br>Children's rain trousers、Children's rain jacket：PFAS(PFCAs)<br>Children's shoes、Leather handbag：Chromium(VI)<br>Children's backpack、Cap：Formaldehyde<br>Gardening gloves：Phthalates(DBP)<br>Children's clothing：Cadmium<br>Purse：Phthalates(DEHP、DBP)、SCCPs |
| Rope straps cause injury and strangulation hazard | GPSR<br>EN 14682 | 5 | Puffer jacket、Raincoat、Children's tracksuit、Tie、Children's jacket |
| Small parts choking hazard | GPSR<br>EN 16732 | 1 | Tie |
| Suffocation hazard | GPSR | 1 | Baby pillow |

**Consumer Testing Technology Co., Ltd.** E-mail: enquiry@cttlab.com http://www.cttlab.com

**Guangdong**
(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)
TEL：+86(0)769-8898 9888-884

**Zhejiang**
(Yiwu/Ningbo)
TEL：0579-8998 6543

**Fujian**
(Quanzhou/Xiamen)
TEL：0595-6809 9099

**Hong Kong**
TEL：+852 9319 8131

**Hanoi, Vietnam**
TEL：+84 024 3928 8688
E-mail: vn@cttlab.com

**Linz, Austria**
TEL：+43 670 1928192
E-mail: eu@cttlab.com

**Vancouver, Canada**
TEL：+1 778 288 5623
E-mail:north.america@cttlab.com

Scan with WeChat for more information.
V 2025.04

### United States CPSC:

| Risk | Regulation / Standard | Notification count | Products |
|---|---|---|---|
| Burn and fire hazard | CPSC<br>16 CFR 1615/1616<br>16 CFR 1610 | 4 | Heated blankets and heating pads、Children's loungewear sets、Electric thows and blankets、Women's sweaters |
| Small parts choking hazard | CPSC | 2 | Baby bibs and stroller bags、Children's sandals |
| Rope straps cause injury and strangulation hazard | CPSC | 1 | Youth clothing with drawstrings |
| Suffocation hazard | 16 CFR 1242<br>16 CFR 1243 | 1 | Nursing pillows |

### Canada HC:

| Risk | Regulation / Standard | Notification count | Products |
|---|---|---|---|
| Burn hazard | SOR/2016-169<br>SOR/2016-194 | 2 | Children's one-piece pajamas、Women's sweaters |

### Australia ACCC:

| Risk | Regulation / Standard | Notification count | Products |
|---|---|---|---|
| Burn hazard | Consumer Goods (Children's Nightwear and Limited Daywear and Paper Patterns for Children's Nightwear) Safety Standard 2017 | 1 | Wearable hooded blanket in child and adult sizes |
| Small parts choking hazard | ACCC | 1 | Garments for newborns and young babies |
| Injury hazard | ACCC | 1 | Women's heels |

## Some typical cases are as follows:



| | |
|---|---|
| Product | Children's rain jacket |
| Country of origin | Bangladesh |
| Alert submitted by | Luxembourg |
| Risk description | In the outer fabric areas of the product, the detected concentrations of C9-C14 PFCA related compounds are exceeding the limit values. These compounds are extremely persistent, environmentally mobile and may accumulate in the environment. The release of these compounds from articles contributes cumulatively to long term and irreversible environmental contamination, leading to a serious environmental risk. |
| Regulation/Standard | REACH |

**Consumer Testing Technology Co., Ltd.**
E-mail: enquiry@cttlab.com http://www.cttlab.com

**Guangdong**
(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)
TEL: +86(0)769-8898 9888-884

**Zhejiang**
(Yiwu/Ningbo)
TEL: 0579-8998 6543

**Fujian**
(Quanzhou/Xiamen)
TEL: 0595-6809 9099

**Hong Kong**
TEL: +852 9319 8131

**Hanoi, Vietnam**
TEL: +84 024 3928 8688
E-mail: vn@cttlab.com

**Linz, Austria**
TEL: +43 670 1928192
E-mail: eu@cttlab.com

**Vancouver, Canada**
TEL: +1 778 288 5623
E-mail:north.america@cttlab.com

Scan with WeChat for more information.
V 2025.04

# SAFE GUARD

CTT-TT-S202603E



| Product | Children's jacket |
|---|---|
| Country of origin | China |
| Alert submitted by | Lithuania |
| Risk description | The product has long drawstrings with free ends at the level of the neck. These drawstrings can become trapped during various activities of a child, leading to strangulation. |
| Regulation/Standard | GPSR、EN 14682 |



| Product | Tie |
|---|---|
| Country of origin | China |
| Alert submitted by | Spain |
| Risk description | The product has a loop to adjust the garment around the neck and it has a sharp element. This could cause choking or strangulation if used by a child. |
| Regulation/Standard | GPSR、EN 14682、EN 16732 |




| Product | Cap |
|---|---|
| Country of origin | China |
| Alert submitted by | Finland |
| Risk description | The product contains formaldehyde (measured value up to 180 mg/kg). Formaldehyde is a skin sensitiser and can trigger allergic reactions and may cause cancer. |
| Regulation/Standard | REACH |



| Product | Children's shoes |
|---|---|
| Country of origin | Unknown |
| Alert submitted by | Poland |
| Risk description | The migration of chromium VI from the textile labels is too high (measured value up to 8.9 mg/kg). Chromium (VI) is sensitising, can trigger allergic reactions and can cause cancer. |
| Regulation/Standard | REACH |



| Product | Women's heels |
|---|---|
| Country of origin | Unknown |
| Alert submitted by | Australia |
| Risk description | The shoe’s heel may become detached during wear without warning. Risk of serious injury from falls if the shoe’s heel detaches while being worn. |
| Regulation/Standard | ACCC |

**Consumer Testing Technology Co., Ltd.**

E-mail: enquiry@cttlab.com http://www.cttlab.com

**Guangdong**
(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)
TEL: +86(0)769-8898 9888-884

**Zhejiang**
(Yiwu/Ningbo)
TEL: 0579-8998 6543

**Fujian**
(Quanzhou/Xiamen)
TEL: 0595-6809 9099

**Hong Kong**
TEL: +852 9319 8131

**Hanoi, Vietnam**
TEL: +84 024 3928 8688
E-mail: vn@cttlab.com

**Linz, Austria**
TEL: +43 670 1928192
E-mail: eu@cttlab.com

**Vancouver, Canada**
TEL: +1 778 288 5623
E-mail:north.america@cttlab.com

Scan with WeChat for more information.

V 2025.04

# SAFE GUARD

CTT-TT-S202603E



| | |
|---|---|
| Product | Children's clothing |
| Country of origin | Unknown |
| Alert submitted by | United Kingdom in respect of Northern Ireland |
| Risk description | The casings of the heart and bow-shaped brooches have an excessive concentration of cadmium. Cadmium is harmful to human health because it accumulates in the body, can damage the kidneys and bones and it may cause cancer. |
| Regulation/Standard | REACH |



| | |
|---|---|
| Product | Children's loungewear sets |
| Country of origin | China |
| Alert submitted by | United States |
| Risk description | The recalled children's loungewear sets violate the mandatory flammability standard for children's sleepwear, posing a risk of serious burn injuries or death. |
| Regulation/Standard | 16 CFR 1615/1616 |



| | |
|---|---|
| Product | Baby bibs and stroller bags |
| Country of origin | United States |
| Alert submitted by | United States |
| Risk description | The snap can detach from the recalled bibs and stroller bags, posing a risk of serious injury or death from a choking hazard to young children. |
| Regulation/Standard | CPSC |



| | |
|---|---|
| Product | Women's sweaters |
| Country of origin | China |
| Alert submitted by | United States; Canada |
| Risk description | The recalled sweaters violate the mandatory standard for clothing textiles, posing a risk of serious burn injuries or death.<br>The recalled V-Neck Pullover and Cardigan Sweaters do not comply with flammability requirements of the Textile Flammability Regulations, posing a burn hazard to consumers. |
| Regulation/Standard | 16 CFR 1610; SOR/2016-194 |


**Consumer Testing Technology Co., Ltd.**

E-mail: enquiry@cttlab.com http://www.cttlab.com

**Guangdong**
(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)
TEL: +86(0)769-8898 9888-884

**Zhejiang**
(Yiwu/Ningbo)
TEL: 0579-8998 6543

**Fujian**
(Quanzhou/Xiamen)
TEL: 0595-6809 9099

**Hong Kong**
TEL: +852 9319 8131


**Hanoi, Vietnam**
TEL: +84 024 3928 8688
E-mail: vn@cttlab.com

**Linz, Austria**
TEL: +43 670 1928192
E-mail: eu@cttlab.com

**Vancouver, Canada**
TEL: +1 778 288 5623
E-mail:north.america@cttlab.com


Scan with WeChat for more information.

V 2025.04

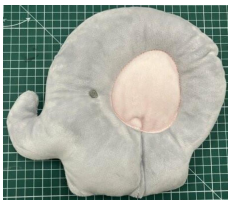

| | |
|---|---|
| Product | Baby pillow |
| Country of origin | China |
| Alert submitted by | United Kingdom in respect of Northern Ireland |
| Risk description | Pillows and soft toys are advised not to be placed in the sleep space for babies under the age of one year as their presence increases the risk of overheating and airway obstruction, which have been associated with sudden infant death syndrome (SIDS). The product may lead to suffocation when used in a sleep space for babies. |
| Regulation/Standard | GPSR |



| | |
|---|---|
| Product | Nursing pillows |
| Country of origin | China |
| Alert submitted by | United States |
| Risk description | The recalled nursing pillows advertised for infant feeding and tummy time violate the mandatory safety standards for nursing pillows and infant support cushions because they can obstruct an infant's breathing, posing a serious risk of injury or death from suffocation. |
| Regulation/Standard | 16 CFR 1242、16 CFR 1243 |

Different markets have different requirements for textiles & leather & shoes & bag products. Therefore, it is particularly important to understand the requirements of export markets for products, especially for children's products, and to design and produce in strict accordance with relevant regulations and standards. Avoid the risk of recalls or claims due to product quality issues.

Referenced web:

https://ec.europa.eu/safety-gate-alerts/screen/search?resetSearch=true

https://www.cpsc.gov/Recalls

https://recalls-rappels.canada.ca/en/search/site

https://www.productsafety.gov.au/recalls

Remark: All pictures above are selected from the referenced web.

**Consumer Testing Technology Co., Ltd.** E-mail: enquiry@cttlab.com http://www.cttlab.com

**Guangdong**
(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)
TEL: +86(0)769-8898 9888-884

**Zhejiang**
(Yiwu/Ningbo)
TEL: 0579-8998 6543

**Fujian**
(Quanzhou/Xiamen)
TEL: 0595-6809 9099

**Hong Kong**
TEL: +852 9319 8131

**Hanoi, Vietnam**
TEL: +84 024 3928 8688
E-mail: vn@cttlab.com

**Linz, Austria**
TEL: +43 670 1928192
E-mail: eu@cttlab.com

**Vancouver, Canada**
TEL: +1 778 288 5623
E-mail:north.america@cttlab.com

Scan with WeChat for more information.
V 2025.04

# 纺织和皮革鞋包类产品召回通报预警—2026年第3期

为了保障消费者的合法权益，欧盟、美国、加拿大和澳大利亚等国家建立了专门的预警通报机制，对不合格产品进行通报。CTT汇总了2026年第三季度纺织和皮革鞋包类产品的通报信息。在该期间，欧盟公布通报案例26例，美国公布通报案例8例，加拿大公布通报案例2例，澳大利亚公布通报案例3例，共39例。所涉及的原产国，包括中国、孟加拉国、柬埔寨、法国、英国、爱尔兰和美国，其中与中国相关的有25例，占64%；所涉及的召回产品风险类型，包括：绳带引起受伤和绞勒危害、烧伤危害、有害化学物质超标危害、窒息危害等。更多详情如下：

**欧盟 RAPEX：**

| 风险类型 | 违反法规/标准 | 通报数量 | 涉及产品大类 |
|---|---|---|---|
| 有害化学物质超标危害 | REACH<br>POPs | 20 | 钱包、化妆包：邻苯二甲酸酯（DEHP）<br>沙发笠、布餐巾：全氟和多氟烷基物质（PFCA、PFOAs）<br>外套、儿童雨衣：全氟和多氟烷基物质（PFCA）<br>儿童雨衣：全氟和多氟烷基物质（PFCAs、PFOAs）<br>防水床垫保护罩：全氟和多氟烷基物质（PFHxA）<br>儿童雨裤、儿童雨衣：全氟和多氟烷基物质（PFCAs）<br>儿童鞋、皮手提包：六价铬<br>儿童背包、帽子：甲醛<br>园艺手套：邻苯二甲酸酯（DBP）<br>儿童服装：镉<br>钱包：邻苯二甲酸酯（DEHP、DBP）、短链氯化石蜡 |
| 绳带引起受伤和绞勒危害 | GPSR<br>EN 14682 | 5 | 羽绒服、雨衣、儿童运动服、领带、儿童夹克 |
| 小部件窒息危害 | GPSR<br>EN 16732 | 1 | 领带 |
| 窒息危害 | GPSR | 1 | 婴儿枕头 |

**美国 CPSC：**

| 风险类型 | 违反法规/标准 | 通报数量 | 涉及产品大类 |
|---|---|---|---|
| 烧伤和起火的危险 | CPSC<br>16 CFR 1615/1616<br>16 CFR 1610 | 4 | 电热毯和加热垫、儿童家居服套装、电热毯、女士毛衣 |
| 小部件窒息危害 | CPSC | 2 | 婴儿围嘴和婴儿车包、儿童凉鞋 |
| 绳带引起受伤和绞勒危害 | CPSC | 1 | 带绳带的青少年服装 |
| 窒息危害 | 16 CFR 1242<br>16 CFR 1243 | 1 | 哺乳枕 |

**加拿大 HC：**

| 风险类型 | 违反法规/标准 | 通报数量 | 涉及产品大类 |
|---|---|---|---|
| 烧伤危害 | SOR/2016-169<br>SOR/2016-194 | 2 | 儿童一体式睡衣、女士毛衣 |

**澳大利亚 ACCC：**

| 风险类型 | 违反法规/标准 | 通报数量 | 涉及产品大类 |
|---|---|---|---|
| 烧伤危害 | Consumer Goods (Children's Nightwear and Limited Daywear and Paper Patterns for Children's Nightwear) Safety Standard 2017 | 1 | 儿童/成人通用可穿戴连帽毯 |
| 小部件窒息危害 | ACCC | 1 | 新生儿及婴幼儿服装 |
| 受伤危害 | ACCC | 1 | 女士高跟鞋 |

**中鼎检测技术有限公司**
E-mail：enquiry@cttlab.com http://www.cttlab.com

**广东**（东莞、深圳、惠州、广州、中山）
TEL：+86(0)769-8898 9888-884

**浙江**（义乌、宁波）
TEL：0579-8998 6543

**福建**（泉州、厦门）
TEL：0595-6809 9099

**香港**
TEL：+852 9319 8131

**越南 河内**
TEL：+84 024 3928 8688
E-mail：vn@cttlab.com

**奥地利 林茨**
TEL：+43 670 1928192
E-mail：eu@cttlab.com

**加拿大 温哥华**
TEL：+1 778 288 5623
E-mail:north.america@cttlab.com

扫描左侧二维码，关注"CTT 中鼎检测"
Scan QR code for more information

## 部分典型案例如下：



| | |
|---|---|
| 产品 | 儿童雨衣 |
| 原产国 | 孟加拉国 |
| 通告国 | 卢森堡 |
| 风险描述 | 在产品的外层织物区域，检测到的C9–C14 PFCA相关化合物浓度已超过限值。这些化合物极为持久，在环境中具有较高的迁移性，并可能在环境中积累。从物品中释放这些化合物会累积性地导致长期且不可逆的环境污染，从而引发严重的环境风险。 |
| 违反法规/标准 | REACH |



| | |
|---|---|
| 产品 | 儿童夹克 |
| 原产国 | 中国 |
| 通告国 | 立陶宛 |
| 风险描述 | 该产品有长抽绳，绳端位于颈部的位置。这些抽绳在儿童的各种活动中可能被缠住，导致窒息。 |
| 违反法规/标准 | GPSR、EN 14682 |



| | |
|---|---|
| 产品 | 领带 |
| 原产国 | 中国 |
| 通告国 | 西班牙 |
| 风险描述 | 该产品有一个环可以调节衣物围绕颈部，并且有一个锋利的部件。如果儿童使用，可能会导致窒息或勒伤。 |
| 违反法规/标准 | GPSR、EN 14682、EN 16732 |




| | |
|---|---|
| 产品 | 帽子 |
| 原产国 | 中国 |
| 通告国 | 芬兰 |
| 风险描述 | 该产品含有甲醛（测量值高达180 mg/kg）。甲醛是一种皮肤致敏物质，可能引发过敏反应，并可能导致癌症。 |
| 违反法规/标准 | REACH |

**中鼎检测技术有限公司**
E-mail：enquiry@cttlab.com http://www.cttlab.com

**广东**（东莞、深圳、惠州、广州、中山）
TEL：+86(0)769-8898 9888-884

**浙江**（义乌、宁波）
TEL：0579-8998 6543

**福建**（泉州、厦门）
TEL：0595-6809 9099

**香港**
TEL：+852 9319 8131

**越南 河内**
TEL：+84 024 3928 8688
E-mail：vn@cttlab.com

**奥地利 林茨**
TEL：+43 670 1928192
E-mail: eu@cttlab.com

**加拿大 温哥华**
TEL：+1 778 288 5623
E-mail:north.america@cttlab.com

扫描左侧二维码，
关注"CTT 中鼎检测"
Scan QR code for
more information

CTT CONSUMER TESTING TECH

# SAFE GUARD

CTT-TT-S202603



| 产品 | 儿童鞋 |
|---|---|
| 原产国 | 未知 |
| 通告国 | 波兰 |
| 风险描述 | 纺织品标签中六价铬的迁移量过高（测量值高达 8.9 mg/kg）。六价铬具有致敏性，可能引发过敏反应并可致癌。 |
| 违反法规/标准 | REACH |



| 产品 | 女士高跟鞋 |
|---|---|
| 原产国 | 未知 |
| 通告国 | 澳大利亚 |
| 风险描述 | 鞋跟在穿着过程中可能会突然脱落。如果鞋跟在穿着时脱落，可能导致跌倒并造成严重伤害的风险。 |
| 违反法规/标准 | ACCC |



| 产品 | 儿童服装 |
|---|---|
| 原产国 | 未知 |
| 通告国 | 英国北爱尔兰 |
| 风险描述 | 服装上的装饰件，心脏形外壳和弓形胸针的镉含量过高。镉对人体健康有害，因为它会在体内积累，可能损害肾脏和骨骼，并且可能导致癌症。 |
| 违反法规/标准 | REACH |



| 产品 | 儿童家居服套装 |
|---|---|
| 原产国 | 中国 |
| 通告国 | 美国 |
| 风险描述 | 被召回的儿童家居服套装违反了儿童睡衣的强制可燃性标准，存在造成严重烧伤或死亡的风险。 |
| 违反法规/标准 | 16 CFR 1615/1616 |



| 产品 | 婴儿围嘴和婴儿车包 |
|---|---|
| 原产国 | 美国 |
| 通告国 | 美国 |
| 风险描述 | 召回的婴儿围嘴和婴儿车包上的按扣可能会脱落，如果吞入口中会对幼儿造成窒息危险，可能导致严重受伤甚至死亡。 |
| 违反法规/标准 | CPSC |


**中鼎检测技术有限公司**

E-mail：enquiry@cttlab.com　http://www.cttlab.com

**广东**（东莞、深圳、惠州、广州、中山）
TEL：+86(0)769-8898 9888-884

**浙江**（义乌、宁波）
TEL：0579-8998 6543

**福建**（泉州、厦门）
TEL：0595-6809 9099

**香港**
TEL：+852 9319 8131

**越南 河内**
TEL：+84 024 3928 8688
E-mail：vn@cttlab.com

**奥地利 林茨**
TEL：+43 670 1928192
E-mail: eu@cttlab.com

**加拿大 温哥华**
TEL：+1 778 288 5623
E-mail:north.america@cttlab.com




扫描左侧二维码，关注"CTT 中鼎检测"
Scan QR code for more information



V 2025.04



| 产品 | 女士毛衣 |
|---|---|
| 原产国 | 中国 |
| 通告国 | 美国；加拿大 |
| 风险描述 | 被召回的毛衣违反了美国服用纺织品易燃性的强制标准，存在严重烧伤或死亡的风险。<br>被召回的毛衣不符合加拿大纺织品易燃性法规的易燃性要求，给消费者带来烧伤危险。 |
| 违反法规/标准 | 16 CFR 1610；SOR/2016-194 |

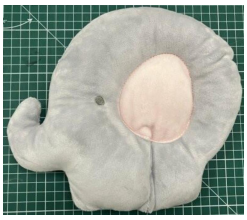

| 产品 | 婴儿枕头 |
|---|---|
| 原产国 | 中国 |
| 通告国 | 英国北爱尔兰 |
| 风险描述 | 不建议将枕头和毛绒玩具放置在一岁以下婴儿的睡眠空间中，因为它们的存在会增加过热和气道阻塞的风险，而这些风险与婴儿猝死综合症（SIDS）相关。该产品在婴儿睡眠空间中使用可能导致窒息。 |
| 违反法规/标准 | GPSR |



| 产品 | 哺乳枕 |
|---|---|
| 原产国 | 中国 |
| 通告国 | 美国 |
| 风险描述 | 因婴儿喂养和俯卧活动而被召回的哺乳枕违反了哺乳枕及婴儿支撑垫的强制性安全标准，因为它们可能阻碍婴儿的呼吸，造成窒息，从而带来严重的受伤或死亡风险。 |
| 违反法规/标准 | 16 CFR 1242、16 CFR 1243 |

各个市场对于纺织品及皮革鞋包类产品的要求不尽相同，因此，了解出口市场对产品的要求，尤其是儿童产品的要求，并严格按照相关法规和标准进行设计和生产则显得尤为重要，避免因产品质量问题而导致召回或产生索赔的风险。

参考网站：

https://ec.europa.eu/safety-gate-alerts/screen/search?resetSearch=true

https://www.cpsc.gov/Recalls

https://recalls-rappels.canada.ca/en/search/site

https://www.productsafety.gov.au/recalls

备注：以上图片均来自以上参考网站。

**中鼎检测技术有限公司**

E-mail：enquiry@cttlab.com http://www.cttlab.com

**广东**（东莞、深圳、惠州、广州、中山）
TEL：+86(0)769-8898 9888-884

**浙江**（义乌、宁波）
TEL：0579-8998 6543

**福建**（泉州、厦门）
TEL：0595-6809 9099

**香港**
TEL：+852 9319 8131

**越南 河内**
TEL：+84 024 3928 8688
E-mail：vn@cttlab.com

**奥地利 林茨**
TEL：+43 670 1928192
E-mail: eu@cttlab.com

**加拿大 温哥华**
TEL：+1 778 288 5623
E-mail:north.america@cttlab.com

扫描左侧二维码，
关注"CTT 中鼎检测"
Scan QR code for
more information