



Textile & Leather & Shoes & Bag Products Recall Notifications - 2025 report 4

In order to protect the legitimate rights and interests of consumers, countries such as the European Union, the United States, Canada and Australia have established special early warning and notification mechanisms to notify substandard products. CTT summarizes the notification information related to textile & leather & shoes & bag products in the fourth quarter of 2025. During this period, the European Union announced 41 notified cases, the United States announced 7 notified cases, Canada announced 2 notified cases, and Australia announced 3 notified cases, for a total of 53 cases. Among the countries of origin involved, including China, India, Portugal, Austria, Bhutan, Estonia, Italy and Vietnam, among which 27 cases were related to China, accounting for 51%; The types of risks involved in the recalled products include: rope straps cause injury and strangulation hazard, burn hazard, chemical hazard, suffocation/choking hazard, etc. More details are as follows:

EU RAPEX:

Risk	Regulation / Standard	Notification count	Products
Chemical hazard	REACH POPs GPSR RoHS 2 Directive	18	Handbag、Slippers、Children's sandals with light up effect: Lead Sandals: Nickel release Leather baseball cap、Leather shoes、Leather sandals: Chromium(VI) Waterproof jacket: PFAS(PFCA) Children's backpack、Cosmetic bag、Rain poncho: Phthalates(DEHP)、SCCPs Slippers: SCCPs Children's slippers: Phthalates(DEHP) Rain coat: PFAS(PFOA、PFCAs) Children's sport shoes with LED light: Lead、Phthalates(DBP) Children's slippers: Lead、Phthalates(DEHP、DBP)
Face covering suffocation hazard	GPSR GPSD	7	Baby sleeping bag
Rope straps cause injury and strangulation hazard	GPSR EN 14682	6	Children's clothing set、Children's jumpsuit、Children's jacket
Small parts choking and cuts hazard	GPSR	6	Children's dress、Children's clothing set、Children's romper
Small parts choking hazard	GPSR EN 71-1	2	Babies' clothing set、Children's sandals
Entanglement injury hazard	GPSR	1	Children's gloves
Strangulation and health risks	GPSR EN 16781	1	Baby sleeping bag

United States CPSC:

Risk	Regulation / Standard	Notification count	Products
Burn hazard	16 CFR 1615/1616	5	Children's pajama sets、Toddler sleep sacks with feet、Children's nightgowns、 Children's robes、Children's loungewear sets
Rope straps cause injury and strangulation hazard	16 CFR 1120	1	Youth jackets

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

Hong Kong

TEL: +852 9319 8131



Scan with
WeChat for more
information.

V 2025.04



Choking/Internal burn hazard	16 CFR 1263	1	Children's LED tutu skirts
------------------------------	-------------	---	----------------------------

Canada HC:

Risk	Regulation / Standard	Notification count	Products
Rope straps cause injury and strangulation hazard	CCPSA	1	Children's rain jackets with drawstrings
Microbial hazard	CCPSA	1	Earflap hats (The product contains mould)

Australia ACCC:

Risk	Regulation / Standard	Notification count	Products
Burn hazard	Consumer Goods (Children's Nightwear and Limited Daywear and Paper Patterns for Children's Nightwear) Safety Standard 2017	3	Kids hooded towel with arm holes、Youth hoodie towel、Hooded towel

Some typical cases are as follows:



Product	Handbag
Country of origin	Bhutan
Alert submitted by	United Kingdom in respect of Northern Ireland
Risk description	The product has an excessive concentration of lead (measured value up to 70232 mg/kg). Lead is harmful to human health, accumulates in the body and may affect breast-fed or unborn children.
Regulation/Standard	REACH、GPSR



Product	Baby sleeping bag
Country of origin	Sri Lanka
Alert submitted by	Ireland
Risk description	The neck opening measure of the sleeping bag is too narrow. This can lead to discomfort, rash and irritation to the baby, as well as strangulation.
Regulation/Standard	GPSR、EN 16781

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Hong Kong

TEL: +852 9319 8131

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com

Vancouver, Canada


TEL: +1 778 288 5623

E-mail: north.america@cttlab.comScan with
WeChat for more
information.

V 2025.04



Product	Waterproof jacket
Country of origin	China
Alert submitted by	France
Risk description	This product contains an excessive quantity of C9-C14 PFCA-related substances (measured value: 456 µg/kg) These substances bio-accumulate in wildlife and humans, posing a risk to human health and the environment.
Regulation/Standard	REACH、GPSR

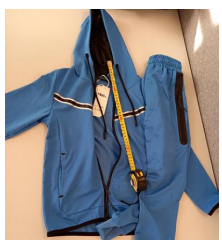

Product	Children's clothing set
Country of origin	China
Alert submitted by	Lithuania
Risk description	The product has long cords in the neck area. These drawstrings can become trapped during various activities of a child, leading to strangulation.
Regulation/Standard	GPSR、EN 14682



Product	Children's gloves
Country of origin	China
Alert submitted by	Ireland
Risk description	While wearing the product, long threads from the product may wrap around the child's finger, causing swelling and a lack of blood flow to the finger, leading to injuries.
Regulation/Standard	GPSR



Product	Baby sleeping bag
Country of origin	Unknown
Alert submitted by	United Kingdom in respect of Northern Ireland
Risk description	The sleeping bag has a hood, which may cover the mouth and/or nose area of the baby. This could lead the child to suffocate.
Regulation/Standard	GPSD



Product	Children's robes
Country of origin	China
Alert submitted by	United States
Risk description	The recalled children's robes violate the mandatory flammability standards for children's sleepwear, posing a risk of burn injuries to children.
Regulation/Standard	16 CFR 1615/1616

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>
Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Hong Kong

TEL: +852 9319 8131

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com
Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com
Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com


V 2025.04

Scan with
WeChat for more
information.



Product	Children's rain jackets with drawstrings
Country of origin	China, Portugal
Alert submitted by	Canada
Risk description	Drawstrings on children's upper outerwear can become caught on playground equipment, fences, or other objects and result in strangulation, or in the case of a vehicle, the child being dragged.
Regulation/Standard	CCPSA



Product	Kids hooded towel with arm holes
Country of origin	China
Alert submitted by	Australia
Risk description	These products don't comply with the mandatory standard for nightwear for children. The products do not have the required fire hazard label.
Regulation/Standard	Consumer Goods (Children's Nightwear and Limited Daywear and Paper Patterns for Children's Nightwear) Safety Standard 2017



Product	Children's dress
Country of origin	India
Alert submitted by	Ireland
Risk description	The poppers can be easily detached, creating small parts. A small child may put them in the mouth and choke. Furthermore, the poppers intended for fastenings are not attached adequately. Consequently, parts of the poppers might become easily accessible, which could lead to cuts.
Regulation/Standard	GPSR



Product	Children's sport shoes with LED light
Country of origin	China
Alert submitted by	Sweden
Risk description	The product has an excessive concentration of lead (measured value up to 81% by weight). The cable insulation has an excessive concentration of dibutyl phthalate (DBP) (measured value up to 0.14% by weight). Lead poses a risk to the environment. DPB poses a risk to human health and the environment.
Regulation/Standard	RoHS 2 Directive

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>
Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Hong Kong

TEL: +852 9319 8131

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com
Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com
Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

Scan with
WeChat for more
information.

V 2025.04



Product	Children's LED tutu skirts
Country of origin	China
Alert submitted by	United States
Risk description	The recalled LED tutu skirts violate the mandatory standard for consumer products containing button cell or coin batteries because the LED lights connected to the skirts contain lithium coin batteries that can be accessed easily by children. Additionally, the tutu skirts do not have the warnings required by Reese's Law. When button cell or coin batteries are swallowed, the ingested batteries can cause serious injuries, internal chemical burns and death.
Regulation/Standard	16 CFR 1263

Different markets have different requirements for textiles & leather & shoes & bag products. Therefore, it is particularly important to understand the requirements of export markets for products, especially for children's products, and to design and produce in strict accordance with relevant regulations and standards. Avoid the risk of recalls or claims due to product quality issues.

Referenced web:

<https://ec.europa.eu/safety-gate-alerts/screen/search?resetSearch=true>

<https://www.cpsc.gov/Recalls>

<https://recalls-rappels.canada.ca/en/search/site>

<https://www.productsafety.gov.au/recalls>

Remark: All pictures above are selected from the referenced web.

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

Hong Kong

TEL: +852 9319 8131



V 2025.04

Scan with
WeChat for more
information.



纺织和皮革鞋包类产品召回通报预警—2025年第4期

为了保障消费者的合法权益，欧盟、美国、加拿大和澳大利亚等国家建立了专门的预警通报机制，对不合格产品进行通报。CTT汇总了2025年第四季度纺织和皮革鞋包类产品的通报信息。在该期间，欧盟公布通报案例41例，美国公布通报案例7例，加拿大公布通报案例2例，澳大利亚公布通报案例3例，共53例。所涉及的原产国，包括中国、印度、葡萄牙、奥地利、不丹、爱沙尼亚、意大利和越南，其中与中国相关的有27例，占51%；所涉及的召回产品风险类型，包括：绳带引起受伤和绞勒危害、烧伤危害、有害化学物质超标危害、窒息危害等。更多详情如下：

欧盟 RAPEX:

风险类型	违反法规/标准	通报数量	涉及产品大类
有害化学物质超标危害	REACH POPs GPSR RoHS 2 Directive	18	手提包、拖鞋、带发光效果的儿童凉鞋：铅 凉鞋：镍释放 皮革棒球帽、皮鞋、皮凉鞋：六价铬 防水夹克：全氟和多氟烷基物质（PFCA） 儿童背包、化妆包、雨披：邻苯二甲酸酯（DEHP）、短链氯化石蜡 拖鞋：短链氯化石蜡 儿童拖鞋：邻苯二甲酸酯（DEHP） 雨衣：全氟和多氟烷基物质（PFOA、PFCA） 带LED灯的儿童运动鞋：铅、邻苯二甲酸酯（DBP） 儿童拖鞋：铅、邻苯二甲酸酯（DEHP、DBP）
蒙面窒息危害	GPSR GPSD	7	婴儿睡袋
绳带引起受伤和绞勒危害	GPSR EN 14682	6	童装套装、儿童连体衣、儿童夹克
小部件窒息和割伤危害	GPSR	6	儿童连衣裙、童装套装、儿童连体衣
小部件窒息危害	GPSR EN 71-1	2	婴儿服装套装、儿童凉鞋
缠绕受伤危害	GPSR	1	儿童手套
勒颈和健康风险	GPSR EN 16781	1	婴儿睡袋

中鼎检测技术有限公司

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

广东（东莞、深圳、惠州、广州、中山）

TEL: +86(0)769-8898 9888-884

浙江（义乌、宁波）

TEL: 0579-8998 6543

福建（泉州、厦门）

TEL: 0595-6809 9099

香港

TEL: +852 9319 8131

越南 河内

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

奥地利 林茨

TEL: +43 670 1928192

E-mail: eu@cttlab.com

加拿大 温哥华

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com



扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information
V 2025.04



美国 CPSC:

风险类型	违反法规/标准	通报数量	涉及产品大类
烧伤危害	16 CFR 1615/1616	5	儿童睡衣裤套装、一体式幼儿睡袋、儿童睡裙、儿童长袍、儿童家居服套装
绳带引起受伤和绞勒危害	16 CFR 1120	1	青少年夹克
窒息/内灼伤危害	16 CFR 1263	1	儿童LED发光芭蕾舞裙

加拿大 HC:

风险类型	违反法规/标准	通报数量	涉及产品大类
绳带引起受伤和绞勒危害	CCPSA	1	儿童雨衣带抽绳
微生物危害	CCPSA	1	耳罩帽（产品上含有霉菌）

澳大利亚 ACCC:

风险类型	违反法规/标准	通报数量	涉及产品大类
烧伤危害	Consumer Goods (Children's Nightwear and Limited Daywear and Paper Patterns for Children's Nightwear) Safety Standard 2017	3	带袖孔的儿童连帽毛巾、青少年连帽毛巾、连帽毛巾

部分典型案例如下:



产品	手提包
原产国	不丹
通告国	英国北爱尔兰
风险描述	该产品铅含量过高（测量值高达 70232 mg/kg）。铅对人类健康有害，会积聚在体内，并可能影响母乳喂养的婴儿或未出生的胎儿。
违反法规/标准	REACH、GPSR

中鼎检测技术有限公司

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

广东（东莞、深圳、惠州、广州、中山）

TEL: +86(0)769-8898 9888-884

浙江（义乌、宁波）

TEL: 0579-8998 6543

福建（泉州、厦门）

TEL: 0595-6809 9099

香港

TEL: +852 9319 8131

越南 河内

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

奥地利 林茨

TEL: +43 670 1928192

E-mail: eu@cttlab.com

加拿大 温哥华

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information
V 2025.04



产品	婴儿睡袋
原产国	斯里兰卡
通告国	爱尔兰
风险描述	这款婴儿睡袋的颈部开口尺寸过小。这可能会导致婴儿感到不适、皮肤过敏和发炎，甚至还会造成勒颈窒息的危险。
违反法规/标准	GPSR、EN 16781



产品	防水夹克
原产国	中国
通告国	法国
风险描述	本产品含有过量的C9-C14 PFCA相关物质（测量值：456 µg/kg）。这些物质会在野生动物和人体内积聚，对人体健康和环境构成风险。
违反法规/标准	REACH、GPSR



产品	童装套装
原产国	中国
通告国	立陶宛
风险描述	该产品在颈部区域有长拉绳。这些拉绳在儿童进行各种活动时可能被缠住，导致绞勒窒息危险。
违反法规/标准	GPSR、EN 14682



产品	儿童手套
原产国	中国
通告国	爱尔兰
风险描述	佩戴该产品时，产品上的长线可能会缠绕在孩子的手指上，导致手指肿胀和血液流动受阻，从而引发受伤。
违反法规/标准	GPSR

中鼎检测技术有限公司

广东 (东莞、深圳、惠州、广州、中山)

TEL: +86(0)769-8898 9888-884

越南 河内

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

浙江 (义乌、宁波)

TEL: 0579-8998 6543

奥地利 林茨

TEL: +43 670 1928192

E-mail: eu@cttlab.com

福建 (泉州、厦门)

TEL: 0595-6809 9099

加拿大 温哥华

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

香港

TEL: +852 9319 8131



扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information
V 2025.04

E-mail: enquiry@cttlab.com <http://www.cttlab.com>



产品	婴儿睡袋
原产国	未知
通告国	英国北爱尔兰
风险描述	睡袋有一个帽子，可能会覆盖婴儿的嘴部和/或鼻子区域。这可能导致孩子窒息。
违反法规/标准	GPSD



产品	儿童长袍
原产国	中国
通告国	美国
风险描述	被召回的儿童长袍不符合儿童睡衣的强制性阻燃标准，存在导致儿童烧伤的风险。
违反法规/标准	16 CFR 1615/1616



产品	儿童雨衣带抽绳
原产国	中国、葡萄牙
通告国	加拿大
风险描述	儿童上衣的拉绳可能会缠绕在游乐设施、围栏或其他物体上，从而导致窒息，或者在车辆中则可能导致儿童被拖拽。
违反法规/标准	CCPSA



产品	带袖孔的儿童连帽毛巾
原产国	中国
通告国	澳大利亚
风险描述	该产品不符合儿童睡衣的强制性标准。这些产品没有所需的防火危险标签。
违反法规/标准	Consumer Goods (Children's Nightwear and Limited Daywear and Paper Patterns for Children's Nightwear) Safety Standard 2017

中鼎检测技术有限公司

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

广东 (东莞、深圳、惠州、广州、中山)

TEL: +86(0)769-8898 9888-884

浙江 (义乌、宁波)

TEL: 0579-8998 6543

福建 (泉州、厦门)

TEL: 0595-6809 9099

香港

TEL: +852 9319 8131

越南 河内

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

奥地利 林茨

TEL: +43 670 1928192

E-mail: eu@cttlab.com

加拿大 温哥华

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information
V 2025.04



产品	儿童连衣裙
原产国	印度
通告国	爱尔兰
风险描述	该产品的按扣可以很容易地被拆开，会产生小部件，小孩子可能会把它们放进嘴里吞咽而发生窒息。此外，用于固定的按扣没有固定好，因此按扣的部分可能会变得很容易接触到，这可能会导致割伤。
违反法规/标准	GPSR



产品	带LED灯的儿童运动鞋
原产国	中国
通告国	瑞典
风险描述	该产品的铅含量过高（测量值高达81%按重量计），电缆绝缘层的邻苯二甲酸二丁酯（DBP）含量过高（测量值高达0.14%按重量计）。铅对环境构成风险，DBP对人类健康和环境构成风险。
违反法规/标准	RoHS 2 Directive



产品	儿童LED发光芭蕾舞裙
原产国	中国
通告国	美国
风险描述	被召回的儿童LED发光芭蕾舞裙不符合有关含纽扣电池或硬币电池的消費品的强制性标准，因为该裙子上连接的LED灯所使用的电池是锂质硬币电池，儿童很容易接触到。此外，该芭蕾舞裙也没有符合里斯法案所要求的警示标识。当纽扣电池或硬币电池被吞食后，摄入的电池可能会造成严重伤害、内部化学灼伤甚至死亡。
违反法规/标准	16 CFR 1263

各个市场对于纺织品及皮革鞋包类产品的要求不尽相同，因此，了解出口市场对产品的要求，尤其是儿童产品的要求，并严格按照相关法规和标准进行设计和生产则显得尤为重要，避免因产品质量问题而导致召回或产生索赔的风险。

参考网站：

<https://ec.europa.eu/safety-gate-alerts/screen/search?resetSearch=true>

<https://www.cpsc.gov/Recalls>

<https://recalls-rappels.canada.ca/en/search/site>

<https://www.productsafety.gov.au/recalls>

备注：以上图片均来自以上参考网站。

中鼎检测技术有限公司

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

广东（东莞、深圳、惠州、广州、中山）

TEL: +86(0)769-8898 9888-884

浙江（义乌、宁波）

TEL: 0579-8998 6543

福建（泉州、厦门）

TEL: 0595-6809 9099

香港

TEL: +852 9319 8131

越南 河内

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

奥地利 林茨

TEL: +43 670 1928192

E-mail: eu@cttlab.com

加拿大 温哥华

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com



扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information
V 2025.04