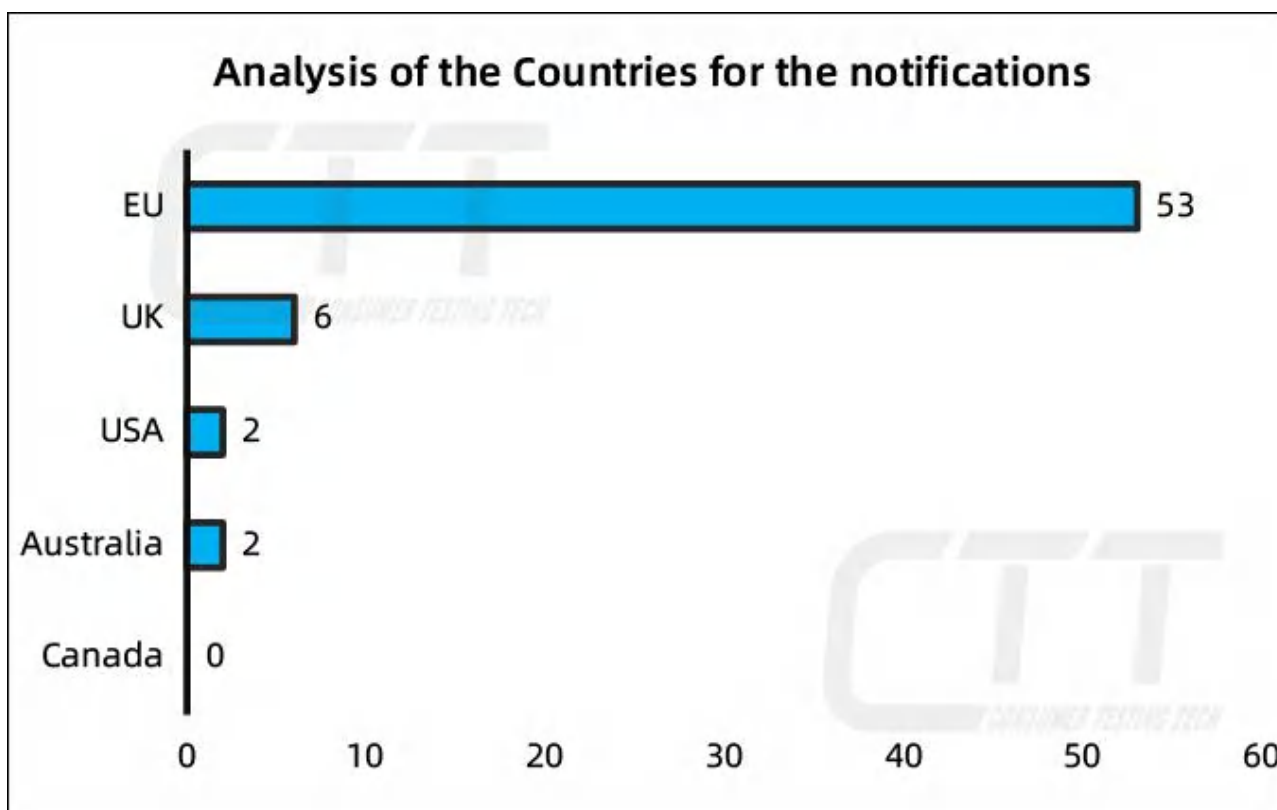




Toy Products Recall Notifications-2025 report 9

In order to protect consumer legitimate rights, the European Union, UK, USA, Canada, Australia together with other countries in the world has established special notification systems to provide information of products which may cause risk to people health and safety.

A total of 53 notifications of children's toys were declared in EU RAPEX are from Ireland, Hungary, Spain, France, Poland, Germany, United Kingdom in respect of Northern Ireland, Cyprus, Sweden, Lithuania, Italy, Austria; 6 notifications in UK official for product safety and Standards website; 0 notifications in Healthy Canadians official website; 2 notifications in Australian product safety recalls official website; 2 notifications in CPSC official website from 36 to 39 week of 2025. Up to 54 notifications of children's toys are from China among all those notifications. Toys were notified because : Contain or release small parts, The seams come easily apart, Contains cords that are excessively long etc. Some toys are subject to notifications for more than one reason.



Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

Hong Kong

TEL: +852 9319 8131

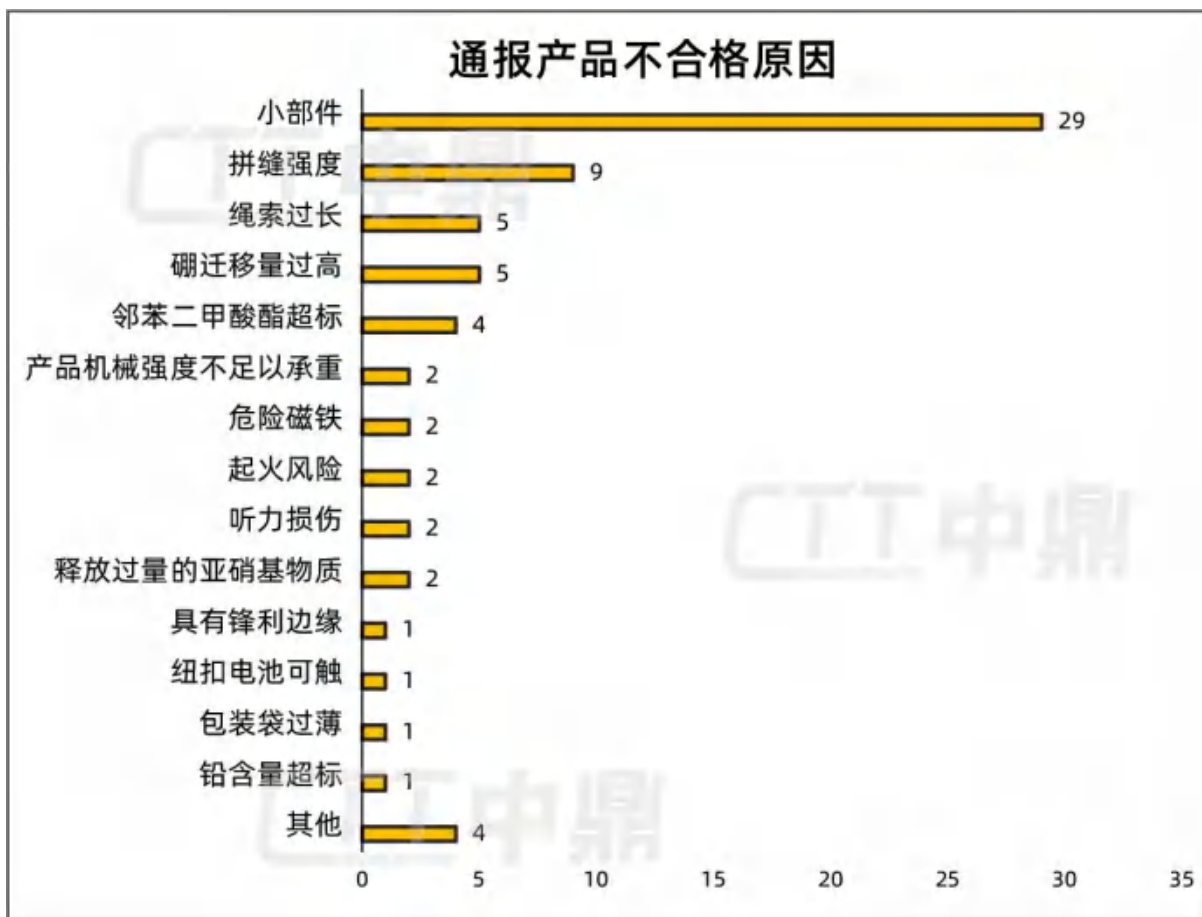


Scan with
WeChat for more
information.

V 2025.04



Toy Products Recall Notifications-2025 report 9



Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Hong Kong

TEL: +852 9319 8131

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com

Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.comScan with
WeChat for more
information.

V 2025.04



Toy Products Recall Notifications-2025 report 9

Risk	Notifying country	Regulation / Standard	Notifica-tion count	Products	Partial Pictures
Choking Contain or release small parts.	Ireland Hungary Spain France Poland Germany United Kingdom in respect of Northern Ireland Cyprus Australia USA UK	EN 71-1 Consumer Goods (Toys for Children up to and including 36 Months of Age) Safety Standard 2023 ASTM F963 Toys (Safety) Regulations 2011	25	Picture book Wooden toy Keyring toy Toy rattle set Felt-tip pens Playmat Baby teether Plastic toy Soft toy Musical toy Puzzle toy Bubble producing toy Teething toy	
Choking The seams come easily apart, making the filling accessible.	France Hungary	EN 71-1	7	Soft toy Keyring	
Chemical The migration of boron from the product is too high.	Italy UK	EN 71-3 Toys (Safety) Regulations 2011	5	Toy slime	

Consumer Testing Technology Co., Ltd.

 E-mail: enquiry@cttlab.com <http://www.cttlab.com>
Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Hanoi, Vietnam

TEL: +84 024 3928 8688

 E-mail: vn@cttlab.com
Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Linz, Austria

TEL: +43 670 1928192

 E-mail: eu@cttlab.com
Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Vancouver, Canada

TEL: +1 778 288 5623

 E-mail: north.america@cttlab.com
Hong Kong

TEL: +852 9319 8131


 Scan with
WeChat for more
information.

V 2025.04



Toy Products Recall Notifications-2025 report 9

Continue:

Risk	Notifying country	Regulation/ Standard	Notifica- tion count	Products	Partial Pictures
Strangulation The toy can stretch too long. A child could swing the toy around the head and twist it around the neck, causing strangulation.	Lithuania Ireland United Kingdom in respect of Northern Ireland	EN 71-1	3	Soft toy Activity toy Sensory toy set	
Chemical Phthalates content exceeds the limit level.	Sweden Hungary	REACH ANNEX XVII	3	Inflatable swim ring Toy doll set Plastic toy	
Injuries The toy contains small magnets with a high magnetic flux.	Australia UK	AS/NZS 8124-1 Toys (Safety) Regulations 2011	2	Magnetic chess game Water Balloon	
Burns The product is highly flammable or may overheat, posing a fire risk.	France	EN 71-2	1	Toy chef's hat	

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Hong Kong

TEL: +852 9319 8131

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com

Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com



Scan with
WeChat for more
information.

V 2025.04



Toy Products Recall Notifications-2025 report 9

Continue:

Risk	Notifying country	Regulation/ Standard	Notifica- tion count	Products	Partial Pictures
Injuries The pushchair is not sufficiently resistant to load. As a consequence, it can easily collapse and a child may fall, leading to injuries.	Lithuania	EN 71-1	1	Toy pushchair	
Damage to hearing The sound pressure level and the peak sound pressure level produced by the toy are too high. This could lead to permanent or partial hearing loss.	Austria	EN 71-1	1	Toy revolver	
Cuts The product contains sharp edges and parts that may be accessible to the user, creating a risk of cuts..	Ireland	EN 71-1	1	Toy car	
Injuries The filling pressure may increase upon pumping, and the product might rupture causing a risk of injuries.	Ireland	Toy Safety Directive	1	Balloon pumper	

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)
 TEL: +86(0)769-8898 9888-884

Zhejiang

(Yiwu/Ningbo)
 TEL: 0579-8998 6543

Fujian

(Quanzhou/Xiamen)
 TEL: 0595-6809 9099

Hong Kong

TEL: +852 9319 8131

Hanoi, Vietnam

TEL: +84 024 3928 8688
 E-mail: vn@cttlab.com

Linz, Austria

TEL: +43 670 1928192
 E-mail: eu@cttlab.com

Vancouver, Canada

TEL: +1 778 288 5623
 E-mail: north.america@cttlab.com



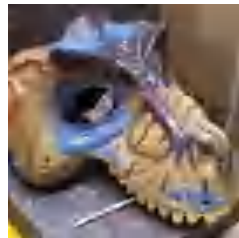
Scan with WeChat for more information.

V 2025.04



Toy Products Recall Notifications-2025 report 9

Continue:

Risk	Notifying country	Regulation/ Standard	Notifica- tion count	Products	Partial Pictures
Injuries The product has an eye shield which can easily detach. Once the shield is detached, two protruding posts and screws are present at or very close to the user's eye level. These screws could contact the eyes or soft skin area during use, causing injuries to the user.	United Kingdom in respect of Northern Ireland	Toy Safety Directive	1	Children's mask	
Choking Release small parts. The seams come easily apart, making the filling accessible.	UK	Toys (Safety) Regulations 2011	1	Plush toy	
Burns The inner bag of the soft toy overheats when warmed in a flatbed microwave. This overheating may cause fire and burns.	France	Toy Safety Directive	1	Heatable soft toy	
Suffocation The plastic of the packaging is too thin. If a child plays with it, the plastic can cover the mouth and nose, causing the child to suffocate.	UK	Toys (Safety) Regulations 2011	1	Inflatable toy	

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)
TEL: +86(0)769-8898 9888-884

Hanoi, Vietnam

TEL: +84 024 3928 8688
E-mail: vn@cttlab.com

Zhejiang

(Yiwu/Ningbo)
TEL: 0579-8998 6543

Linz, Austria

TEL: +43 670 1928192
E-mail: eu@cttlab.com

Fujian

(Quanzhou/Xiamen)
TEL: 0595-6809 9099

Vancouver, Canada

TEL: +1 778 288 5623
E-mail: north.america@cttlab.com

Hong Kong

TEL: +852 9319 8131



Scan with
WeChat for more
information.

V 2025.04



Toy Products Recall Notifications-2025 report 9

Continue:

Risk	Notifying country	Regulation/ Standard	Notifica- tion count	Products	Partial Pictures
Environment Lead content exceeds the limit level.	Sweden	RoHS 2 Directive	1	Children digital camera	
Chemical The rubber of the balloons releases an excessive amount of nitrosatable substances (NDMA).	Germany	EN 71-12	1	Balloons	
Entrapment, Injuries The mechanical strength of the toy is inadequate, the toy may dismantle during use, leading to injuries. There are accessible gaps between moving parts of the tricycle. A child's leg may become trapped there and be injured.	Poland	EN 71-1	1	Toy tricycle	
Choking, Damage to hearing Contain small parts. The sound pressure level and the peak sound pressure level produced by the toy are too high. This could lead to permanent or partial hearing loss.	Poland	EN 71-1	1	Toy whistle set	

Toy Products Recall Notifications-2025 report 9

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Hong Kong

TEL: +852 9319 8131

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com

Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

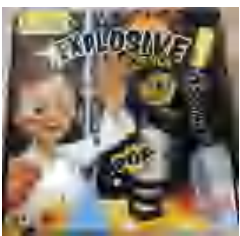


Scan with
WeChat for more
information.

V 2025.04



Continue:

Risk	Notifying country	Regulation/ Standard	Notifica- tion count	Products	Partial Pictures
Chemical, Choking Phthalates content exceeds the limit level. Release small parts.	Hungary	REACH ANNEX XVII EN 71-1	1	Bath toy	
Chemical, Damage to sight The rubber of the balloons releases an excessive amount of nitrosatable substances (NDMA). The design of the safety goggles is inappropriate to protect against droplets. As a consequence, the user could suffer damage to sight from exposure to chemicals.	France	EN 71-4 EN 71-12	1	Experimental toy set	
Chemical, Choking The button batteries are easily accessible. A child may put them in the mouth, which could cause them to choke or they can be swallowed, which could cause damage to the child's gastrointestinal tract.	USA	ASTM F963	1	Crib toy	
Choking, Strangulation The compartment's velcro fastener provides inadequate protection, allowing access to both electrical cables and fibrous stuffing. This presents strangulation and choking hazards to small children.	Poland	EN 71-1	1	Soft toy	

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Hong Kong

TEL: +852 9319 8131

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com

Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com



Scan with WeChat for more information.

V 2025.04



Toy Products Recall Notifications-2025 report 9

Continue:

Risk	Notifying country	Regulation/ Standard	Notifica- tion count	Products	Partial Pictures
Choking, Injuries, Strangulation Contain small parts. The retractable cord is too long and can become trapped during various activities of a child, leading to strangulation or injuries.	France	EN 71-1	1	Key ring with soft toy	

Referenced web:

- <https://ec.europa.eu/safety-gate-alerts/screen/search?resetSearch=true>
- <https://www.cpsc.gov/Recalls>
- <https://recalls-rappels.canada.ca/en/search/site>
- <https://www.productsafety.gov.au/recalls>
- <https://www.gov.uk/product-safety-alerts-reports-recalls?>

Remark: All pictures above are selected from the referenced web.

Consumer Testing Technology Co., Ltd.

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

Guangdong

(Dongguan/Shenzhen/Huizhou/Guangzhou/Zhongshan)

TEL: +86(0)769-8898 9888-884

Hanoi, Vietnam

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

Zhejiang

(Yiwu/Ningbo)

TEL: 0579-8998 6543

Linz, Austria

TEL: +43 670 1928192

E-mail: eu@cttlab.com

Fujian

(Quanzhou/Xiamen)

TEL: 0595-6809 9099

Vancouver, Canada

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

Hong Kong

TEL: +852 9319 8131

Scan with
WeChat for more
information.

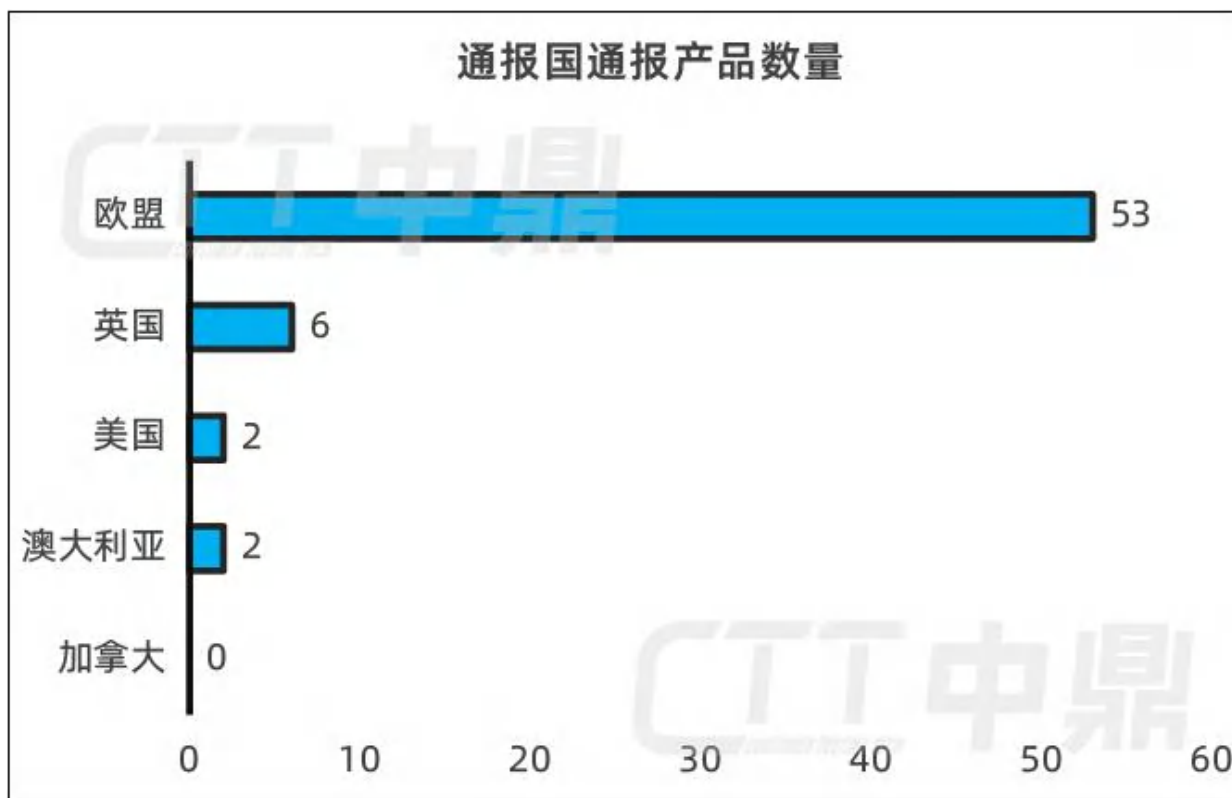
V 2025.04



玩具产品召回通报预警-2025年第9期

为了保障消费者的合法权益，欧盟、英国、美国、加拿大、澳大利亚等国均建立了专门的预警通报机制，对不合格的玩具产品进行通报。

2025年第36-39周，欧盟RAPEX通报公布的玩具通报案例共53例，来自爱尔兰、匈牙利、西班牙、法国、波兰、德国、北爱尔兰、塞浦路斯、瑞典、立陶宛、意大利、奥地利；英国产品安全与标准部门官网6例，加拿大卫生部官网0例，澳大利亚产品安全召回官网2例，美国CPSC官网2例。所有的通报案例当中原产国是中国的案例高达54例，涉及的通报原因包括含有或易产生小部件，拼缝强度低，含有过长绳索等，部分玩具涉及的通报原因不止一项。



中鼎检测技术有限公司

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

广东 (东莞、深圳、惠州、广州、中山)

TEL: +86(0)769-8898 9888-884

浙江 (义乌、宁波)

TEL: 0579-8998 6543

福建 (泉州、厦门)

TEL: 0595-6809 9099

香港

TEL: +852 9319 8131

越南 河内

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

奥地利 林茨

TEL: +43 670 1928192

E-mail: eu@cttlab.com

加拿大 温哥华

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com

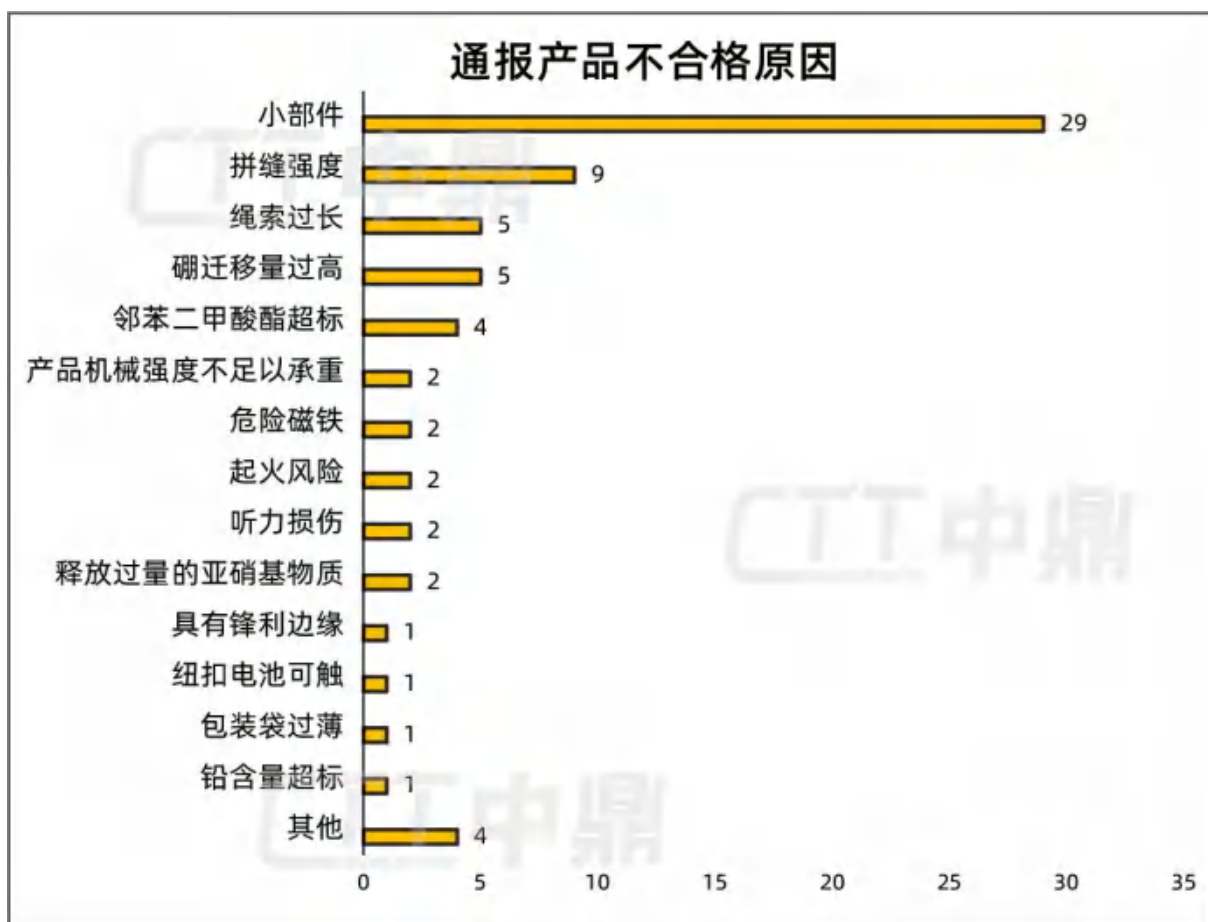


扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information

V 2025.04



玩具产品召回通报预警-2025年第9期



中鼎检测技术有限公司

E-mail: enquiry@cttlab.com <http://www.cttlab.com>

广东 (东莞、深圳、惠州、广州、中山)

TEL: +86(0)769-8898 9888-884

浙江 (义乌、宁波)

TEL: 0579-8998 6543

福建 (泉州、厦门)

TEL: 0595-6809 9099

香港

TEL: +852 9319 8131

越南 河内

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

奥地利 林茨

TEL: +43 670 1928192

E-mail: eu@cttlab.com

加拿大 温哥华

TEL: +1 778 288 5623

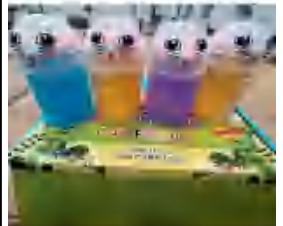
E-mail: north.america@cttlab.com

扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information

V 2025.04



玩具产品召回通报预警-2025年第9期

通报原因	通报国	违反法规/标准	通报数量	涉及产品	部分产品图片
窒息 含有或易产生小部件。	爱尔兰 匈牙利 西班牙 法国 波兰 德国 北爱尔兰 塞浦路斯 澳大利亚 美国 英国	EN 71-1 Consumer Goods (Toys for Children up to and including 36 Months of Age) Safety Standard 2023 ASTM F963 Toys (Safety) Regulations 2011	25	图画玩具书 木质玩具 钥匙玩具挂件 玩具摇铃套装 毡头笔 玩具垫 婴儿牙胶玩具 塑料玩具 软体填充玩具 玩具乐器 拼图玩具 泡泡机玩具 出牙玩具	
窒息 玩具接缝容易裂开，导致填充物可触。	法国 匈牙利	EN 71-1	7	软体填充玩具 钥匙玩具挂件	
化学 产品的硼迁移量过高。	意大利 英国	EN 71-3 Toys (Safety) Regulations 2011	5	玩具史莱姆	
绞杀 可伸缩绳索过长存在缠绕勒死风险。	立陶宛 北爱尔兰 爱尔兰	EN 71-1	3	软体填充玩具 活动玩具 感官玩具套装	

中鼎检测技术有限公司

E-mail: enquiry@cttlab.com http://www.cttlab.com

广东 (东莞、深圳、惠州、广州、中山)
TEL: +86(0)769-8898 9888-884

浙江 (义乌、宁波)
TEL: 0579-8998 6543

福建 (泉州、厦门)
TEL: 0595-6809 9099

香港
TEL: +852 9319 8131

越南 河内
TEL: +84 024 3928 8688
E-mail: vn@cttlab.com

奥地利 林茨
TEL: +43 670 1928192
E-mail: eu@cttlab.com

加拿大 温哥华
TEL: +1 778 288 5623
E-mail: north.america@cttlab.com



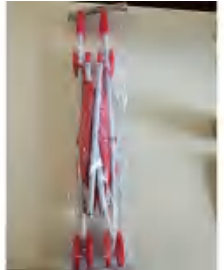
扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information

V 2025.04



玩具产品召回通报预警-2025年第9期

续：

通报原因	通报国	违反法规/标准	通报数量	涉及产品	部分产品图片
化学 邻苯二甲酸酯含量超标。	瑞典 匈牙利	REACH ANNEX XVII	3	充气泳圈 玩偶套装 塑料玩具	
伤害 产品含小型高能磁铁。	澳大利亚 英国	AS/NZS 8124-1 Toys (Safety) Regulations 2011	2	磁性国际象棋 磁吸水球玩具	
烧伤 产品高度易燃或可能过热，存在火灾风险。	法国	EN 71-2	1	玩具厨师帽	
伤害 该产品这的结构承重能力不足。这可能导致推车在受力时意外坍塌，致使车内儿童跌落并受伤。	立陶宛	EN 71-1	1	玩具推车	

中鼎检测技术有限公司

E-mail: enquiry@cttlab.com http://www.cttlab.com

广东 (东莞、深圳、惠州、广州、中山)
TEL: +86(0)769-8898 9888-884

浙江 (义乌、宁波)
TEL: 0579-8998 6543

福建 (泉州、厦门)
TEL: 0595-6809 9099

香港
TEL: +852 9319 8131

越南 河内
TEL: +84 024 3928 8688
E-mail: vn@cttlab.com

奥地利 林茨
TEL: +43 670 1928192
E-mail: eu@cttlab.com

加拿大 温哥华
TEL: +1 778 288 5623
E-mail: north.america@cttlab.com



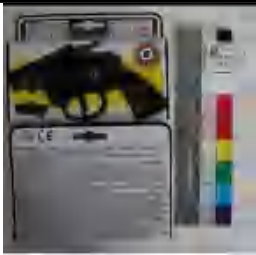
扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information

V 2025.04



玩具产品召回通报预警-2025年第9期

续:

通报原因	通报国	违反法规/标准	通报数量	涉及产品	部分产品图片
听力损伤 声压过高可能导致听力损伤或听力丧失的风险。	奥地利	EN 71-1	1	玩具手枪	
割伤 产品含有锋利边缘有割伤风险。	爱尔兰	EN 71-1	1	玩具车	
伤害 水瓶可能被注水超出容量或加压过量，导致瓶子爆炸，造成伤害风险。	爱尔兰	Toy Safety Directive	1	气球充气泵	
伤害 产品带有一个可轻易脱落的眼罩。一旦眼罩脱落，两个突出的柱体和螺丝会出现在使用者眼部高度或非常接近的位置。在使用过程中，这些螺丝可能接触到眼睛或柔软皮肤区域，对使用者造成伤害。	北爱尔兰	Toy Safety Directive	1	儿童玩具面罩	

中鼎检测技术有限公司

E-mail: enquiry@cttlab.com http://www.cttlab.com

广东 (东莞、深圳、惠州、广州、中山)
TEL: +86(0)769-8898 9888-884浙江 (义乌、宁波)
TEL: 0579-8998 6543福建 (泉州、厦门)
TEL: 0595-6809 9099香港
TEL: +852 9319 8131越南 河内
TEL: +84 024 3928 8688
E-mail: vn@cttlab.com奥地利 林茨
TEL: +43 670 1928192
E-mail: eu@cttlab.com加拿大 温哥华
TEL: +1 778 288 5623
E-mail: north.america@cttlab.com扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information

V 2025.04



玩具产品召回通报预警-2025年第9期

续:

通报原因	通报国	违反法规/标准	通报数量	涉及产品	部分产品图片
窒息 易产生小部件。玩具接缝容易裂开，导致填充物可触。	英国	Toys (Safety) Regulations 2011	1	毛绒玩具	
烧伤 该毛绒玩具的内袋在平板微波炉中加热时会过热。产品有过热起火的风险可能导致烧伤。	法国	Toy Safety Directive	1	可加热软体玩具	
窒息 包装袋过薄，如果儿童玩耍包装袋可能会覆盖儿童的口鼻造成窒息。	英国	Toys (Safety) Regulations 2011	1	充气玩具	
环境 铅含量超标。	瑞典	RoHS 2 Directive	1	儿童数码相机	

中鼎检测技术有限公司

E-mail: enquiry@cttlab.com http://www.cttlab.com

广东 (东莞、深圳、惠州、广州、中山)
TEL: +86(0)769-8898 9888-884浙江 (义乌、宁波)
TEL: 0579-8998 6543福建 (泉州、厦门)
TEL: 0595-6809 9099香港
TEL: +852 9319 8131越南 河内
TEL: +84 024 3928 8688
E-mail: vn@cttlab.com奥地利 林茨
TEL: +43 670 1928192
E-mail: eu@cttlab.com加拿大 温哥华
TEL: +1 778 288 5623
E-mail: north.america@cttlab.com扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information

V 2025.04



玩具产品召回通报预警-2025年第9期

续:

通报原因	通报国	违反法规/标准	通报数量	涉及产品	部分产品图片
化学 释放过量的亚硝基物质 (NDMA)。	德国	EN 71-12	1	气球	
卡陷 伤害 该产品机械强度不足，在 使用过程中可能解体，导 致伤害风险。三轮车活动 部件之间存在可触及间 隙，儿童腿部可能被卡住 并受伤。	波兰	EN 71-1	1	玩具三轮车	
窒息 听力损伤 含有小部件，声压过高可 能导致听力损伤或听力丧 失的风险。	波兰	EN 71-1	1	玩具口哨套装	
化学 窒息 邻苯二甲酸酯含量超标。 产品易产生小部件。	匈牙利	REACH ANNEX XVII EN 71-1	1	沐浴玩具	

中鼎检测技术有限公司

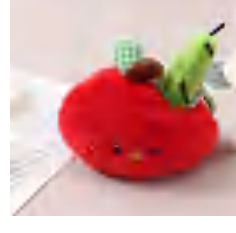
E-mail: enquiry@cttlab.com http://www.cttlab.com

广东 (东莞、深圳、惠州、广州、中山)
TEL: +86(0)769-8898 9888-884浙江 (义乌、宁波)
TEL: 0579-8998 6543福建 (泉州、厦门)
TEL: 0595-6809 9099香港
TEL: +852 9319 8131越南 河内
TEL: +84 024 3928 8688
E-mail: vn@cttlab.com奥地利 林茨
TEL: +43 670 1928192
E-mail: eu@cttlab.com加拿大 温哥华
TEL: +1 778 288 5623
E-mail: north.america@cttlab.com扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information
V 2025.04



玩具产品召回通报预警-2025年第9期

续：

通报原因	通报国	违反法规/标准	通报数量	涉及产品	部分产品图片
化学 视力损伤 释放过量的亚硝基物质 (NDMA)。护目镜的设计不适合防飞沫，使用者可能会因接触化学物质而视力受损。	法国	EN 71-4 EN 71-12	1	实验玩具套装	
化学 窒息 纽扣电池易接触。孩子可能会把它们放进嘴里，导致窒息或对孩子的胃肠道造成损害。	美国	ASTM F963	1	婴儿床玩具	
化学 窒息 绞杀 产品接缝容易裂开，导致填充物可触且产品绳索过长存在缠绕勒死风险。	波兰	EN 71-1	1	软体填充玩具	
窒息 伤害 绞杀 含有小部件，产品的伸缩绳过长，在儿童进行各种活动时可能被卡住，导致勒颈或受伤风险。	法国	EN 71-1	1	钥匙玩偶挂件	

参考网站：

- <https://ec.europa.eu/safety-gate-alerts/screen/search?resetSearch=true>
- <https://www.cpsc.gov/Recalls>
- <https://recalls-rappels.canada.ca/en/search/site>
- <https://www.productsafety.gov.au/recalls>
- <https://www.gov.uk/product-safety-alerts-reports-recalls?>

备注：以上图片均来自以上参考网站。

中鼎检测技术有限公司

E-mail: enquiry@cttlab.com http://www.cttlab.com

广东 (东莞、深圳、惠州、广州、中山)

TEL: +86(0)769-8898 9888-884

浙江 (义乌、宁波)

TEL: 0579-8998 6543

福建 (泉州、厦门)

TEL: 0595-6809 9099

香港

TEL: +852 9319 8131

越南 河内

TEL: +84 024 3928 8688

E-mail: vn@cttlab.com

奥地利 林茨

TEL: +43 670 1928192

E-mail: eu@cttlab.com

加拿大 温哥华

TEL: +1 778 288 5623

E-mail: north.america@cttlab.com



扫描左侧二维码，
关注“CTT 中鼎检测”
Scan QR code for
more information

V 2025.04